

TECHNICAL BULLETIN
LTB00451
30 APR 2012



© Jaguar Land Rover Limited
All rights reserved.

SECTION: 307-00

8HP70 8-Speed Automatic Transmission Holding Gear at Wide Open Throttle and 3-2 Downshift Throttle Application from Low Speed

AFFECTED VEHICLE RANGE:

Discovery 4 / LR4 (LA) - 3.0L TDV6 Automatic	Model Year:	2012 Onwards
	VIN:	CA596988-CA625890
Range Rover Sport (LS) - 3.0L TDV6 Automatic	Model Year:	2012 Onwards
	VIN:	CA717166-CA751745

MARKETS:

All

CONDITION SUMMARY:

Situation:

The Customer may complain of the following –

- 1) That whilst driving at high speed the transmission is holding 6th or 7th gear with the engine speed on the limiter with the accelerator pedal pressed down at wide open throttle (not kickdown).
- 2) Poor response when applying throttle from a low speed due to gear shift mapping (3-2 downshift).


Cause:

Software issues.

Suggested Customer Concern Code P69.

Action: Should a customer express concern, follow the Service Instruction outlined below.

WARRANTY:

 **NOTE:** Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.

 **NOTE:** DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME	CONDITION CODE	CAUSAL PART
Automatic Transmission - Tune Download	44.90.10	0.4	42	LR023295

 **NOTE:** Normal Warranty policies and procedures apply.

SERVICE INSTRUCTION:

1.  **CAUTION:** This procedure requires SDD DVD129.06 and Calibration File 104 loaded or later.

Connect the Land Rover approved battery conditioner/power supply.